RS0088, RS0089, RS0090, RS0091 und RS0127

Montageanweisung

PIN Belegung		TIA/EIA T568A	TIA/EIA T568B
	1	Weiß/Grün	Weiß/Orange
	2	Grün	Orange
	3	Weiß/Orange	Weiß/Grün
	4	Blau	Blau
	5	Weiß/Blau	Weiß/Blau
	6	Orange	Grün
	7	Weiß/Braun	Weiß/Braun
	8	Braun	Braun

① Vor der Montage die Transportsicherung entfernen.

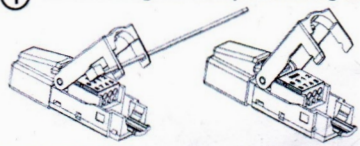

ungeschirmtes Gehäuse abgeschirmtes Gehäuse

② Kabel in Knickschutztülle einführen.Kabelmantel ca. 30mm absetzen, Schimgeflecht und Beidraht sorgfältig zurückbiegen.

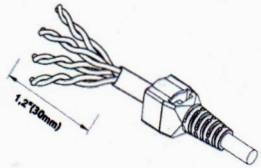

Knickschutztülle anpassen

Knickschutztülle auf korrekten Kabeldurchmesser kürzen.



③ Kabeladem aufdrehen und entsprechend Farbcode im Kabelmanager positionieren. Kabelenden kürzen.

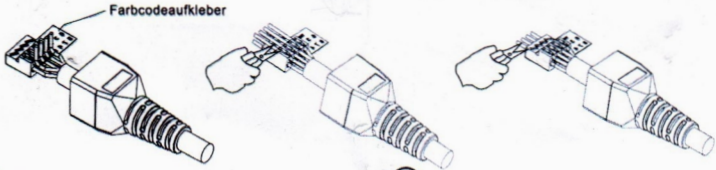

④ Kabelmanager positionieren

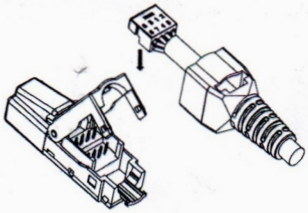

⑤ Konfektionierten Kabelmanager auf Stecker positionieren und mit einer Zange fixieren bis dieser einrastet und eine sichere Verbindung gewährleistet.

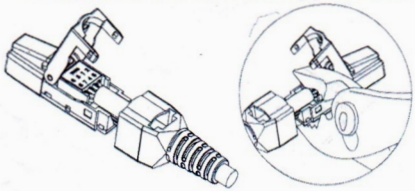

⑥ Steckerabdeckung schließen und sicherstellen, dass der Beidraht einen guten Kontakt zum Gehäuse hat. Knickschutztülle über den Stecker schieben und mit Kabelbinder fixieren.

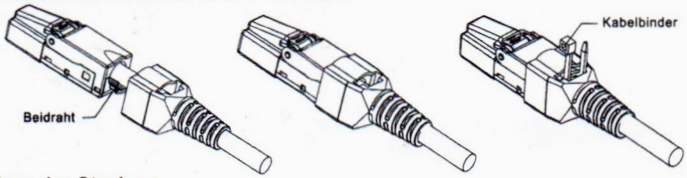

Demontage des Steckers

Kabelbinder entfemen und Knickschutztülle zurück schieben. Mit einem flachen Schraubendreher die beiden Enden nacheinander aufhebeln und die Steckerabdeckung öffnen.

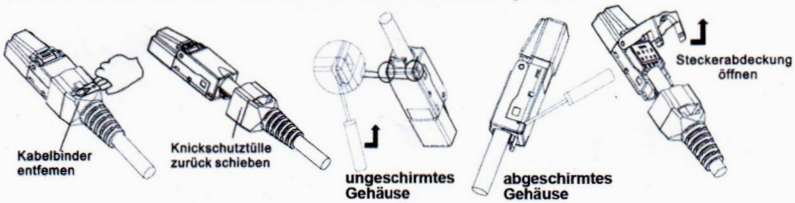

Instruction Manual

JACK PIN DESIGNATIONS		TIA/EIA T568A	TIA/EIA T568B
	1	White/Green	White/Orange
	2	Green	Orange
	3	White/Orange	White/Green
	4	Blue	Blue
	5	White/Blue	White/Blue
	6	Orange	Green
	7	White/Brown	White/Brown
	8	Brown	Brown

① Remove the Cable tie before installation.

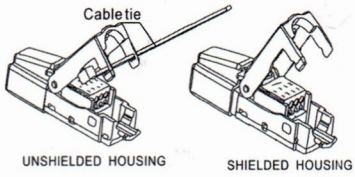

② Insert cable into strain relief boot, strip off 1.2 inch of cable jacket ,fold back braid and drain wire.

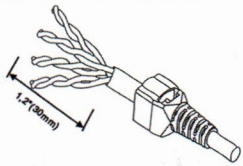

Boot adjustment

Cut the end of boot to fit your cable OD.



③ Fan out all four twisted pairs, following the color coding label and allocate each conductor into proper slots on wiring cap. Trim the ends of conductors.

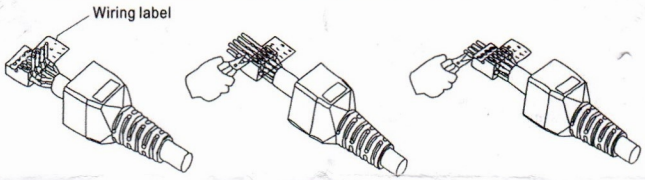

④ Place wiring cap on plug.

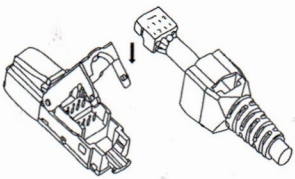

⑤ Place the wiring cap onto plug,use pller to clamp wiring cap until it completely snap-in to effect the connection.

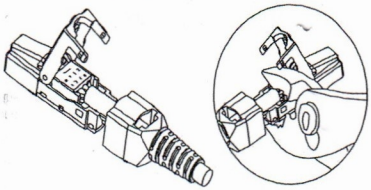

⑥ Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug.
Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.

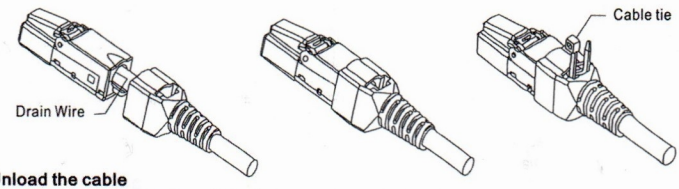

Unload the cable
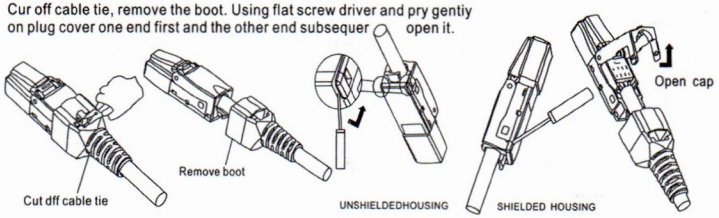
Cur off cable tie, remove the boot. Using flat screw driver and pry gentiy on plug cover one end first and the other end subsequer open it.